

SERVICE BULLETIN



BRIGGS & STRATTON, LLC

YOU.POWERED.

TO:	NOTIFIED CUSTOMERS	CRITICAL CORRECTION - ACTION AND RESPONSE REQUIRED IMMEDIATELY	<input checked="" type="checkbox"/>
BULLETIN NUMBER:	21-0006-NL-GR	ACTION REQUIRED - FIX, NO REPORT	<input type="checkbox"/>
DATE OF NOTICE	3/30/21	IF ENCOUNTERED - CORRECT IF ISSUE IS FOUND	<input checked="" type="checkbox"/>
SUBJECT:	NL-GR SERIES DIESEL UPDATES	INFORMATION ONLY	<input type="checkbox"/>
PRODUCT LINE:	NL-GR SERIES		
MODEL:	DIESEL	AUTHORIZED LABOR CHARGES FOR THIS BULLETIN:	
		.5 HR / \$50 PER UNIT	
SERIAL NUMBERS:	25-000001 - 25-000410	PART NUMBERS REQUIRED TO CORRECT THIS BULLETIN:	
		SEE BULLETIN ITEMS	
EXPIRATION DATE:	4/30/2021		
DESCRIPTION OR SUMMARY OF PROBLEM TO BE CORRECTED:			
1. The exhaust tail pipe vibrates continuously causing breaks in the tailpipe and bracket. 2. Remove the existing tail pipe and bracket. Replace with updated tailpipe and exhaust bracket.			
CORRECTIONS AND INSTRUCTION:			
See attached brochure for installation instructions #122017			
CONTACT INFORMATION: FOR ADDITIONAL CLARIFICATION OR FURTHER INSTRUCTIONS, PLEASE CONTACT THE FOLLOWING: TECHNICAL SERVICES @ 1(308)995-3431			

SERVICE BULLETIN



BRIGGS & STRATTON, LLC

YOU.POWERED.

Item 1: Remove existing tailpipe and exhaust bracket.

PARTS REQUIRED:

1 each of P/N 120705P & 116998



CORRECTION:


STEP 1:

Open rear door and disconnect tail light harness. Then remove the front and back cover that are both attached to the lift bow. Set the doors and all the hardware to the side.



STEP 2:

Locate the tailpipe and remove both clamps and set to the side. Remove current tailpipe and discard. Remove the current tailpipe bracket by loosening 2 M10x8 hex head screws. discard bracket and reinstall screws.

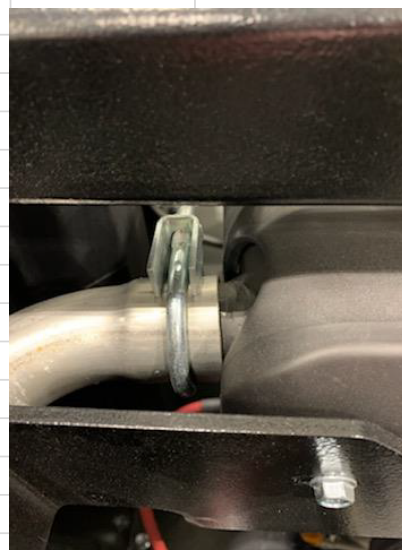

SERVICE BULLETIN



BRIGGS & STRATTON, LLC

YOU.POWERED.

Item 2: Install updated tailpipe with bracket

PARTS REQUIRED:

1 each of P/N 120705P , 1 each of P/N 116998 , 2 each of P/N 112211



STEP 1:

Install the new tailpipe with bracket using the engine M12x35 hex head flange screw hardware where the slot cut out center is fully engaged with bolt threads before tightening.

STEP 2:

Reinstall the 1-5/8 muffler exhaust clamps (qty 2). Make sure that the tailpipe is concentric to side panel exhaust cut out.

STEP 3:

Reinstall the roof panel door subassembly by using 1/4-20 x 3/4 hex flange screws (qty. 6) that are used to bolt the roof panel to the lift bow. Reconnect the 4 pin tail light harness and close the door.